



SOUND TRANSMISSION LOSS TEST REPORT NO. TL21-339

CLIENT: **Deluxe Building Products**
3534 Philadelphia St
Chino, CA 91710

17 November 2021

TEST DATE: 10 November 2021

INTRODUCTION

The test was performed in accordance with ASTM E 90-09 (2016), *Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions* and ASTM E2235-04 (2020), *Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods*. Copies of the test standard are available at www.astm.org. The test chamber source and receiving room volumes are 204 and 148.4 cubic meters respectively. Western Electro-Acoustic Laboratory is accredited by the United States Department of Commerce, National Institute of Standards and Technology under the National Voluntary Accreditation Program (NVLAP) Lab Code 100256-0 for this test procedure. This test report relates only to the item(s) tested. This report must not be used to claim product certification, approval, or endorsement by WEAL, NVLAP, NIST or any agency of the U.S. government.

DESCRIPTION OF TEST SPECIMEN

The test specimen was a single steel stud wall with type 'x' gypsum board, Deluxe Building Products studs and resilient channel, and R-13 fiberglass insulation.

Specimen Make-up (Source to Receive)	
Layer 1	16 mm (5/8 inch) type 'x' gypsum board
Layer 2	16 mm (5/8 inch) type 'x' gypsum board
Framing and Insulation	92 mm (3-5/8 inch) Deluxe Building Products 362S125-33-8 steel studs and Deluxe Building Products 362T125-33-8 track with R-13 fiberglass batt insulation in the cavity
Resilient Attachment	13 mm (1/2 inch) Deluxe Building Products RC 1 resilient channel
Layer 3	16 mm (5/8 inch) type 'x' gypsum board
Layer 4	16 mm (5/8 inch) type 'x' gypsum board
Installation Information	
Layer Installation	<ul style="list-style-type: none"> - Layer 1: 51 mm (2 inch) long #6 drywall screws spaced 203 mm (8 inches) on center (o.c.) at the perimeter and 305 mm (12 inches) o.c. in the field. - Layer 2: 29 mm (1-1/8 inch) long #6 drywall screws spaced 610 mm (24 inches) o.c. at the perimeter and 610 mm (24 inches) o.c. in the field. - Layer 3: 25 mm (1 inch) long #6 drywall screws spaced 610 mm (24 inches) o.c. along the resilient channel. - Layer 4: 41 mm (1-5/8 inch) long #6 drywall screws spaced 305 mm (12 inches) o.c. along the resilient channel. - All gypsum board was oriented vertically with joints staggered on opposite sides of the wall. - All joints and perimeters were sealed with a bead of caulking and metal foil tape.
Resilient Attachment Installation	<ul style="list-style-type: none"> - Channel was installed to the studs using 13 mm (1/2 inch) pan-head truss screws. - Channel was spaced vertically 610 mm (24 inches) o.c. and 51 mm (2 inches) from the top and bottom of the wall.
Framing and Insulation Installation	<ul style="list-style-type: none"> - Studs were spaced 610 mm (24 inches) o.c. and were crimped to the track. - R-13 fiberglass batt insulation was friction-fit in the stud cavities. - The frame was isolated from the test opening with 6.3 mm (1/4 inch) neoprene pads.



SOUND TRANSMISSION LOSS TEST REPORT NO. TL21-339

CLIENT: **Deluxe Building Products**

3534 Philadelphia St
Chino, CA 91710

17 November 2021

TEST DATE: 10 November 2021

- The overall dimensions of the specimen were 2.44 m (96 inches) wide by 2.44 m (96 inches) high by 168 mm (6-5/8 inches) thick.
- The overall weight of the assembly was estimated to be 354 kg (782 lbs.) for a calculated surface density of 59.6 kg/m² (12.2 lbs./ft²).

RESULTS OF THE MEASUREMENTS

One-third octave band sound transmission loss values are plotted and tabulated on the attached sheet. ASTM minimum volume requirements are met at 80 Hz and above. The Outdoor-Indoor Transmission Class rating determined in accordance with ASTM E 1332-10a was OITC-44. The Sound Transmission Class rating determined in accordance with ASTM E 413-10 was STC-57.

Respectfully submitted,

Approved:

Western Electro-Acoustic Laboratory

Stephen A. Martin, Ph.D., P.E.
Laboratory Director

Raul Martinez
Acoustical Test Technician




SOUND TRANSMISSION LOSS TEST REPORT NO. TL21-339

CLIENT: **Deluxe Building Products**

3534 Philadelphia St
Chino, CA 91710

17 November 2021

TEST DATE: 10 November 2021

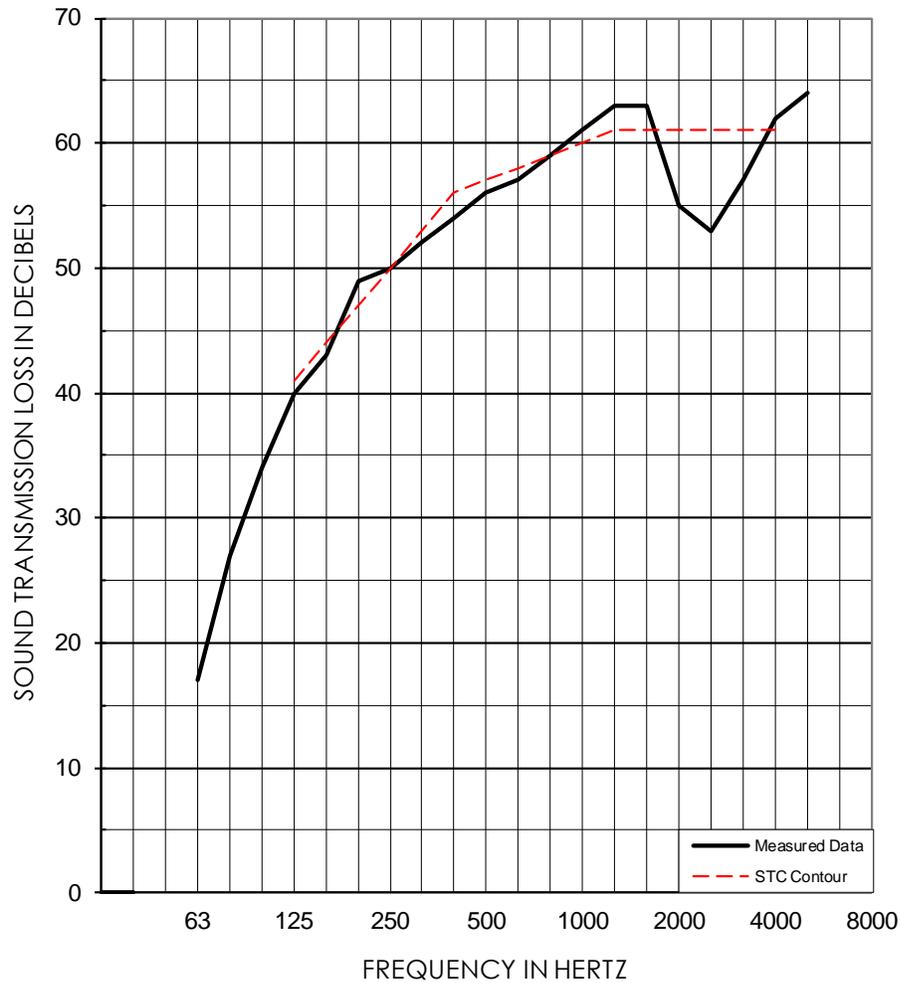

1/3 OCT BAND CNTR FREQ	63	80	100	125	160	200	250	315	400	500
TL in dB	17	27	34	40	43	49	50	52	54	56
95% Confidence in dB deficiencies	1.42	1.92	2.07	1.47	0.89	0.76	0.80	0.52	0.36	0.38
				(1)	(1)		(0)	(1)	(2)	(1)
1/3 OCT BAND CNTR FREQ	630	800	1000	1250	1600	2000	2500	3150	4000	5000
TL in dB	57	59	61	63	63	55	53	57	62	64
95% Confidence in dB deficiencies	0.29	0.44	0.38	0.39	0.36	0.56	0.55	0.31	0.32	0.50
	(1)	(0)				(6)	(8)	(4)		

EWR	OITC	Test Date: 10 November 2021	STC
58	44	Specimen Area: 64 sq.ft.	57
		Temperature: 74.7 deg. F	(25)
		Relative Humidity: 31 %	

Report must be distributed in its entirety except with written permission from Western Electro-Acoustic Laboratory



SOUND TRANSMISSION LOSS TEST REPORT NO. TL21-339

CLIENT: **Deluxe Building Products**

3534 Philadelphia St
Chino, CA 91710

17 November 2021

TEST DATE: 10 November 2021

PHOTO OF TEST SPECIMEN

